

Coordinamento della Sicurezza

Arch. Vincenzo Mainardi



Borgo della Salnitrra 4 - 43121 Parma v.mainardi@momarchiteti.it



PROSPETTO SUD

Architectural section drawing of a building facade. The roof is covered in brown tiles. The facade is divided into several colored zones: green areas with dense foliage patterns, yellow areas with a grid pattern, and a central blue vertical element. Red lines indicate structural or spatial divisions. The drawing is labeled 'PROSPETTIVA NON OGGETTO DI INTERVENTO' on the right side.

PROSPETTO NORD

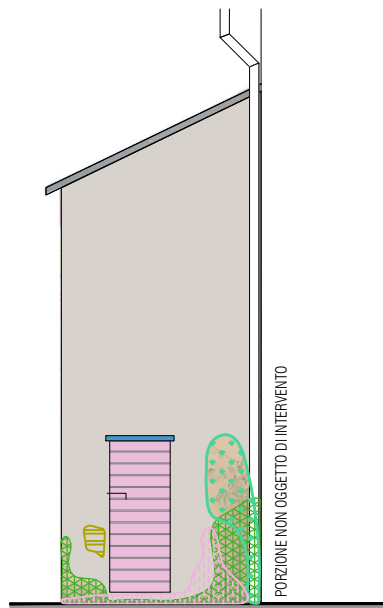

PROSPETTO OVEST

INTONACO		LATERIZIO		METALLO	
DEGRADO	INTERVENTI	DEGRADO	INTERVENTI	DEGRADO	INTERVENTI
DISTACCO	PL1, IN2, TF1, TF2	EROSIONE DEPOSITO SUPERFICIALE	AS3, PL1, PL4, IN3, IN2, C01 PL4, IN3, IN2, TF1, TF2	OSSIDAZIONE DANNEGGIAMENTO VETUSTÀ SERRAMENTI	PL6 AS1 PL6, IN4, TF3
UMIDITÀ DI RISALITA	PL2, TF1, TF2				
MACCHIA DA DILAVAMENTO	PL1, TF1, TF2				
MACCHIA	PL1, TF1, TF2				
FESSURAZIONE	PL1, IN1, TF1, TF2	LEGNO			
VEGETAZIONE	PC1, AS4, PL1, PL3, TF1, TF2	DEGRADO	INTERVENTI		
PATINA BIOLOGICA	PL1, PL3, TF1, TF2	DEPOSITO SUPERFICIALE	AS2, PL5		
ALTERAZIONE CROMATICA	PL2, TF1, TF2				
DEPOSITO SUPERFICIALE	PL1, TF1, TF2				

NB Per le descrizioni specifiche dei degradi e degli interventi si rimanda agli elaborati:

- SCHEDE DEGRADI E INTERVENTI
- CAPITOLATO SPECIALE D'APPALTO – PARTE TECNICA – ARCHITETTONICO
- C.M.E.